



IDAHO DEPARTMENT OF  
HEALTH & WELFARE

C.L. "BUTCH" OTTER – Governor  
RICHARD M. ARMSTRONG – Director

DEBBY RANSOM, R.N., R.H.I.T – Chief  
BUREAU OF FACILITY STANDARDS  
3232 Elder Street  
P.O. Box 83720  
Boise, Idaho 83720-0036  
PHONE: (208) 334-6626  
FAX: (208) 364-1888  
E-mail: [fsb@dhw.idaho.gov](mailto:fsb@dhw.idaho.gov)

June 4, 2009

Ferren Weeks, Administrator  
Yellowstone Group Homes #3 (Hoopes)  
560 West Sunnyside Lane  
Idaho Falls, Idaho 83401

RE: Yellowstone Group Homes #3 (Hoopes), Provider #13G065

Dear Mr. Weeks:

This is to advise you of the findings of the Medicaid/Licensure Fire Life Safety Survey, which was concluded at Yellowstone Group Homes #2 (Sunnybrook), on May 13, 2009.

Enclosed is a Statement of Deficiencies/Plan of Correction, Form CMS-2567, listing Medicaid deficiencies and a similar form listing State licensure deficiencies. In the spaces provided on the right side of each sheet, please provide a Plan of Correction. **It is important that your Plan of Correction address each deficiency in the following manner:**

1. What corrective action(s) will be accomplished for those individuals found to have been affected by the deficient practice;
2. How you will identify other individuals having the potential to be affected by the same deficient practice and what corrective action(s) will be taken;
3. What measures will be put in place or what systemic change you will make to ensure that the deficient practice does not recur;
4. How the corrective action(s) will be monitored to ensure the deficient practice will not recur, i.e., what quality assurance program will be put into place; and,
5. Include dates when corrective action will be completed. 42 CFR 488.28 states ordinarily a provider is expected to take the steps needed to achieve compliance within 60 days of being notified of the deficiencies. Please keep this in mind when preparing your plan of

Ferren Weeks, Administrator  
June 4, 2009  
Page 2 of 2

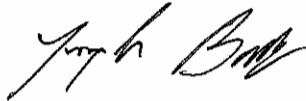
correction. For corrective actions which require construction, competitive bidding, or other issues beyond the control of the facility, additional time may be granted.

Sign and date the form(s) in the space provided at the bottom of the first page.

After you have completed your Plan of Correction, return the original to this office by **June 17, 2009**, and keep a copy for your records.

Thank you for the courtesies extended to us during our visit. If you have any questions, please call or write this office at (208)334-6626.

Sincerely,

A handwritten signature in black ink, appearing to read "Taylor Barkley", written in a cursive style.

TAYLOR BARKLEY  
Health Facility Surveyor  
Facility Fire Safety and Construction Program

TB/lj

Enclosures

DEPARTMENT OF HEALTH AND HUMAN SERVICES  
CENTERS FOR MEDICARE & MEDICAID SERVICESPrinted: 06/04/2009  
FORM APPROVED  
OMB NO. 0938-0391

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  <b>13G065</b>	(X2) MULTIPLE CONSTRUCTION A. BUILDING <b>02</b> B. WING _____		(X3) DATE SURVEY COMPLETED  <b>05/13/2009</b>
NAME OF PROVIDER OR SUPPLIER <b>YELLOWSTONE GROUP HOME #3 (HOOPES)</b>			STREET ADDRESS, CITY, STATE, ZIP CODE <b>1949 HOOPES IDAHO FALLS, ID 83404</b>		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)		ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
K 000	INITIAL COMMENTS  The facility is a single story, type V(000) construction. It is a fully sprinklered 13-D system with Quick Response sprinkler heads and has a complete fire alarm/smoke detection system. The home was built on April 10, 1998 and currently licensed for 6 ICF/MR beds.  The facility was surveyed in accordance with applicable fire/life safety requirements set forth in the Life Safety Code, 2000 edition, Chapter 33, Existing Residential Board and Care Occupancy, Impractical Evacuation Capability. The survey was conducted under 42 CFR 483.470.  The deficiencies identified during this survey are listed below.  The annual life safety code survey was conducted by:  Taylor Barkley Health Facility Surveyor Facility Fire/Life Safety and Construction Program		K 000		
K0056	483.470(j)(1)(i) LIFE SAFETY CODE STANDARD  PROMPT Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7, 33.2.3.5.2 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction.  Exception No. 1: In prompt evacuation facilities,		K0056	<i>Please refer to the attached plan of correction</i>  <i>fzw</i>	<i>6/16/09</i>

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

TITLE

(X6) DATE

*Arden J. Wilson**Administrator**6/15/09*

Any deficiency statement ending with an asterisk (\*) denotes a deficiency which the institution may be excused from correcting providing it is determined that other safeguards provide sufficient protection to the patients. (See instructions.) Except for nursing homes, the findings stated above are disclosable 90 days following the date of survey whether or not a plan of correction is provided. For nursing homes, the above findings and plans of correction are disclosable 14 days following the date these documents are made available to the facility. If deficiencies are cited, an approved plan of correction is requisite to continued program participation.

DEPARTMENT OF HEALTH AND HUMAN SERVICES  
CENTERS FOR MEDICARE & MEDICAID SERVICES

Printed: 06/04/2009  
FORM APPROVED  
OMB NO. 0938-0391

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  <b>13G065</b>	(X2) MULTIPLE CONSTRUCTION A. BUILDING <b>02</b> B. WING _____		(X3) DATE SURVEY COMPLETED  <b>05/13/2009</b>
NAME OF PROVIDER OR SUPPLIER <b>YELLOWSTONE GROUP HOME #3 (HOOPES)</b>			STREET ADDRESS, CITY, STATE, ZIP CODE <b>1949 HOOPES IDAHO FALLS, ID 83404</b>		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE	
K0056	<p>Continued From page 1</p> <p>an automatic sprinkler system in accordance with NFPA 13D, Standard for the Installation of Sprinkler Systems in One and two Family Dwellings and Manufactured Homes, is permitted. Automatic sprinklers are not required in closets not exceeding 24 sq. ft. and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.</p> <p>Exception No. 2: Not applicable</p> <p>Exception No. 3: In prompt and slow evacuation capability facilities where an automatic sprinkler system is in accordance with NFPA 13, Standard for the Installation of Sprinkler Systems, automatic sprinklers are not required in closets not exceeding 24 sq. ft and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or material providing a 15 minute thermal barrier.</p> <p>Exception No. 4: In prompt and slow evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in Residential Occupancies up to and Including Four Stories in Height, are permitted.</p> <p>Exception No. 5: Not applicable</p> <p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5.</p> <p><b>SLOW</b></p> <p>Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7 and activates the fire alarm system in accordance with</p>	K0056			

DEPARTMENT OF HEALTH AND HUMAN SERVICES  
CENTERS FOR MEDICARE & MEDICAID SERVICES

Printed: 06/04/2009  
FORM APPROVED  
OMB NO. 0938-0391

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  <b>13G065</b>	(X2) MULTIPLE CONSTRUCTION A. BUILDING <b>02</b> B. WING _____		(X3) DATE SURVEY COMPLETED  <b>05/13/2009</b>
NAME OF PROVIDER OR SUPPLIER <b>YELLOWSTONE GROUP HOME #3 (HOOPES)</b>			STREET ADDRESS, CITY, STATE, ZIP CODE <b>1949 HOOPES IDAHO FALLS, ID 83404</b>		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE	
K0056	<p>Continued From page 2</p> <p>33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction.</p> <p>Exception No. 1: Not Applicable</p> <p>Exception No. 2: Not Applicable</p> <p>Exception No. 3: In prompt and slow evacuation capability facilities where an automatic sprinkler system is in accordance with NFPA 13, Standard for the Installation of Sprinkler Systems, automatic sprinklers are not required in closets not exceeding 24 sq. ft. and in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or material providing a 15 minute thermal barrier.</p> <p>Exception No. 4: In prompt and slow evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in Residential Occupancies up to and including Four Stories in Height, are permitted.</p> <p>Exception No. 5: Not Applicable</p> <p>Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5.</p> <p>IMPRACTICAL Where an automatic sprinkler system is installed, for either total or partial building coverage, the system is in accordance with Section 9.7 and activates the fire alarm system in accordance with 33.2.3.4.1. The adequacy of the water supply is documented to the authority having jurisdiction. 33.2.3.5.2.</p> <p>Exception No. 1: Not Applicable.</p>	K0056			

DEPARTMENT OF HEALTH AND HUMAN SERVICES  
CENTERS FOR MEDICARE & MEDICAID SERVICES

Printed: 06/04/2009  
FORM APPROVED  
OMB NO. 0938-0391

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  <b>13G065</b>	(X2) MULTIPLE CONSTRUCTION A. BUILDING <b>02</b> B. WING _____	(X3) DATE SURVEY COMPLETED  <b>05/13/2009</b>
NAME OF PROVIDER OR SUPPLIER <b>YELLOWSTONE GROUP HOME #3 (HOOPES)</b>		STREET ADDRESS, CITY, STATE, ZIP CODE <b>1949 HOOPES IDAHO FALLS, ID 83404</b>		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
K0056	Continued From page 3  Exception No. 2: In slow and impractical evacuation capability facilities, an automatic sprinkler system in accordance with NFPA 13D, Standard for the Installation of Sprinkler Systems in One and Two Family Dwellings and Manufactured Homes, with a 30 minute water supply, is permitted. All habitable areas and closets are sprinklered. Automatic sprinklers are not required in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.  Exception No. 3: Not Applicable.  Exception No. 4: Not Applicable.  Exception No. 5: In impractical evacuation capability facilities up to and including four stories in height, systems in accordance with NFPA 13R, Standard for the Installation of Sprinkler Systems in Residential Occupancies up to and Including Four Stories in Height, are permitted. All habitable areas and closets are sprinklered. Automatic sprinklers are not required in bathrooms not exceeding 55 sq. ft., provided that such spaces are finished with lath and plaster or materials providing a 15 minute thermal barrier.  Exception No. 6: Initiation of the fire alarm system is not required for existing installations in accordance with 33.2.3.5.5.  This Standard is not met as evidenced by: Based on observation and record review it was determined that the facility failed to ensure that the automatic sprinkler system was inspected	K0056		

DEPARTMENT OF HEALTH AND HUMAN SERVICES  
CENTERS FOR MEDICARE & MEDICAID SERVICESPrinted: 06/04/2009  
FORM APPROVED  
OMB NO. 0938-0391

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  <b>13G065</b>	(X2) MULTIPLE CONSTRUCTION A. BUILDING <b>02</b> B. WING _____		(X3) DATE SURVEY COMPLETED  <b>05/13/2009</b>
NAME OF PROVIDER OR SUPPLIER <b>YELLOWSTONE GROUP HOME #3 (HOOPES)</b>			STREET ADDRESS, CITY, STATE, ZIP CODE <b>1949 HOOPES IDAHO FALLS, ID 83404</b>		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)		ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
K0056	Continued From page 4 annually in accordance with NFPA 25.  Findings include:  During record review on May 13 at 9:45 AM the facility could not produce a current annual fire sprinkler system inspection report. Further observation of the tag on the sprinkler riser revealed it was dated 2007 and the month and day were not noted on the tag. The findings were observed and noted by facility maintenance director and surveyor.		K0056		

6/16/09

Plan of correction for the fire life safety survey of Yellowstone Group Home #3 (Hoopes) conducted May 13<sup>th</sup> of 2009.

Upon learning of the findings from the survey inspection on May 13<sup>th</sup>, 3-D Fire Protection the established inspection provider was contacted our deficiencies and scheduled a prompt inspection. The inspections were by the maintenance supervisor Matt Cordon. He discussed completed on May 20 of 2009. A copy of the inspection is enclosed. Mr. Cordon then discussed with the agency their records and lack of notification that the inspections were due. He also discussed the need to properly tag the system. All contact information was verified to ensure their ability to notify us in the future.

In addition the facility's preventive maintenance program will be revised by July 1 to definitely alert the maintenance supervisor of the due dates of preventive maintenance tasks not just leaving it up to contracted services. This will be accomplished by closely tying the preventive maintenance schedule to our monthly administrative calendar which is reviewed at least weekly by all the home administrators. Ferren Weeks the Regional Administrator will be responsible for its completion by July 1.

*Ferren J. Weeks 6/16/09*  
*Admission / BMRP*



## Bureau of Facility Standards

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  <b>13G065</b>	(X2) MULTIPLE CONSTRUCTION A. BUILDING <b>02</b> B. WING _____	(X3) DATE SURVEY COMPLETED  <b>05/13/2009</b>
NAME OF PROVIDER OR SUPPLIER <b>YELLOWSTONE GROUP HOME #3 (HOOPES)</b>		STREET ADDRESS, CITY, STATE, ZIP CODE <b>1949 HOOPES IDAHO FALLS, ID 83404</b>		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
M 000	<p>16.03.11 Initial Comments</p> <p>The facility is a single story, type V(000) construction. It is a fully sprinklered 13-D system with Quick Response sprinkler heads and has a complete fire alarm/smoke detection system. The home was built on April 10, 1998 and currently licensed for 6 ICF/MR beds.</p> <p>The facility is a single story, type V(000) construction. It is fully sprinklered with Quick Response sprinkler heads. It has a complete fire alarm/smoke detection system. This home was built/completed on February 23, 1998. Currently it is licensed for 6 ICF/MR beds.</p> <p>The survey was conducted in accordance with applicable fire/life safety requirements set forth in IDAPA 16.03.11 Rules Governing Intermediate Care Facilities for the Mentally Retarded (ICF/MR).</p> <p>The deficiencies identified during this survey are listed below.</p> <p>The annual life safety code survey was conducted by:</p> <p>Taylor Barkley Health Facility Surveyor Facility Fire/Life Safety and Construction Program</p>	M 000		
MM309	<p>16.03.11.110 Fire and Life Safety Standards</p> <p>Buildings on the premises used as facilities must meet all the requirements of local, state and national codes concerning fire and life safety standards that are applicable to ICF/MR facilities. This Rule is not met as evidenced by:</p> <p>Refer to federal deficiencies listed on the CMS</p>	MM309	<p>Refer to K0056 J2W</p>	6/16/09

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

TITLE

(X6) DATE

STATE FORM

021199

9LLH21

If continuation sheet 1 of 2

PRINTED: 06/04/2009  
FORM APPROVED

## Bureau of Facility Standards

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  <b>13G065</b>	(X2) MULTIPLE CONSTRUCTION A. BUILDING <b>02</b> B. WING _____		(X3) DATE SURVEY COMPLETED  <b>05/13/2009</b>
NAME OF PROVIDER OR SUPPLIER <b>YELLOWSTONE GROUP HOME #3 (HOOPES)</b>			STREET ADDRESS, CITY, STATE, ZIP CODE <b>1949 HOOPES IDAHO FALLS, ID 83404</b>		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)		(X5) COMPLETE DATE
MM309	Continued From Page 1  2567 form.  1. K056 Annual inspection of the automatic fire sprinkler system.	MM309			

STATE FORM

021198

9LLH21

If continuation sheet 2 of 2